

INSPECTION OFFICER ORDER NO. \underline{GC} - $\underline{001}$ - $\underline{2016}$

IN THE MATTER OF THE NATIONAL ENERGY BOARD ACT, AN ORDER UNDER SECTION 51.1

	Full name or the recipient			
is employ	ed by, and/or is a person conducting, and/or is a person conducting			
an excav	ation or construction on or near a facility located at <u>all stations operated by TCPL</u> .			
On <u>18</u> 8	On 18 and 19 July 2016 , the undersigned <i>National Energy Board</i> Inspection Officer conducted			
an inspe	An inspection Kingston Meter Station Location on R.O.W., compressor, pump or meter station			
The Inspection Officer has reasonable grounds to believe:				
-The 2 mr	minimum remaining wall thickness (MRWT) value for blasting the pipe referenced in TCPL's Operating Pipeline Defect Assessment and Repair Procedures (ID # 003674615) poses a safety risk to all excavation			
	esponse to NEB Inspectors' Information Request (IR) question 2 to provide the rationale for relying on the mm is unacceptable and is not in compliance with CSA Z662-15, clause 10.2.8.			
-TCPL's response to NEB Inspectors' IR question 3 to include in every Technical Memorandum for Safe Dig Pressure Determination (Technical Memo) a minimum allowable wall thickness (MAWT) calculation is unacceptable and is not in compliance with CSA Z662-15, clause 10.2.8.				
	the inspection officer shall describe the grounds for making the order			
Based on the above mentioned, the inspection officer has reasonable grounds to believe that a hazard to the safety or security of the public, or employees of a company or a detriment to property or the environment is being or will be caused by the construction, operation, maintenance or abandonment of the pipeline, or excavation activity or construction of a facility as per 49(2)(a).				
Therefore	,is HEREBY ORDERED,			
pursuant to sections 51.1 and 51.1(2) of the National Energy Board Act, to				
the sa	neasures specified below for guarding fety or security of the public or yees or protecting property or the nment Suspend work until the hazard or detrimental situation has been remedied to the satisfaction of the inspection officer; or the order is stayed or rescinded by the Board			
Specified	Measures:			
-TCPL sh	-TCPL shall not excavate any station pining until			

Revised October 2014

Document #: 282391

Activity or Incident #: CV1617-271 Canada



1) TCPL provides documented evidence to the NEB Inspectors for review and approval that it has modified its

Operating Procedure Pipeline Defect Assessment and Repair Procedures (ID # 003674615) to remove all references to the universal 2 mm MRWT value for blasting the pipe; and

2) TCPL provides documented evidence to the NEB Inspectors for review and approval that it has included a MAWT calculation for each type of piping expected to be encountered considering all types of pipe grade, outside diameter (OD) and operating stress level in every Technical Memo.

Increasion Officer	1950 IO Designation #	
Inspection Officer	1 September 2016 Date	Signature
	517 10th Avenue SW Calgary AB T2R 0A8	

Activity or Incident #: CV1617-271 Canada